GP1FA501TZ/ GP1FA501RZ

Shutter System Fiber Optic Transmitter/ Receiver

■ Features

1. Shutter system unnecessary to remove the protection cap
2. Uni-diretional data transmission using plastic optical fiber cable
3. The optical receiver can be directly connectable the TTL, due to the use of OPIC

■ Applications

1. DVD players
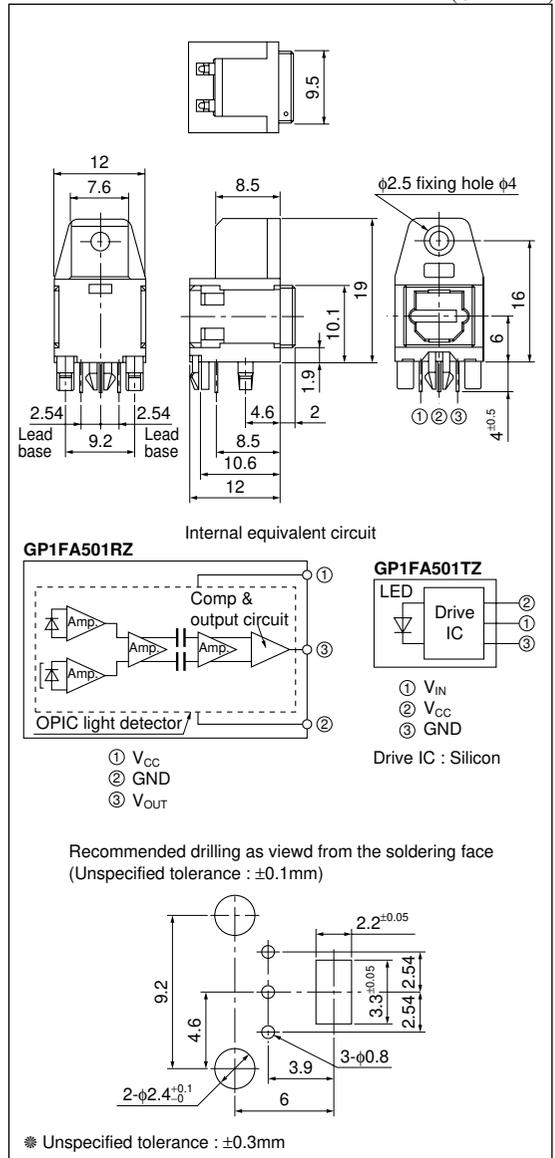2. CD players
3. MD players

■ Absolute Maximum Ratings   (T_a=25°C)

Parameter	Symbol	Rating	Unit
Supply voltage	V_{CC}	−0.5 to +7.0	V
Output current **(GP1FA501RZ)**	I_{OH}	4 (Source current)	mA
	I_{OL}	4 (Sink current)	
Input voltage **(GP1FA501TZ)**	V_{IN}	−0.5 to V_{CC} +0.5	V
Operating temperature	T_{opr}	−20 to +70	°C
Storage temperature	T_{stg}	−30 to +80	°C
[*1] Soldering temperature	T_{sol}	260	°C

*1 For 5s (2 times or less)

■ Outline Dimensions   (Unit : mm)

Internal equivalent circuit

GP1FA501RZ

Comp & output circuit

OPIC light detector

① V_{CC}
② GND
③ V_{OUT}

GP1FA501TZ

LED — Drive IC

① V_{IN}
② V_{CC}
③ GND

Drive IC : Silicon

Recommended drilling as viewd from the soldering face
(Unspecified tolerance : ±0.1mm)

※ Unspecified tolerance : ±0.3mm

＊ "OPIC"(Optical IC) is a trademark of the SHARP Corporation. An OPIC consists of a light-detecting element and signal-processing circuit integrated onto a single chip.

■ Recommended Operating Conditions (GP1FA501TZ) $(T_a=25°C)$

Parameter	Symbol	MIN.	TYP.	MAX.	Unit
Operating supply voltage	V_{CC}	4.75	5.0	5.25	V
[*2] Operating transfer rate	T	–	–	8	Mb/s

*2 NRZ signal duty 50%

■ Recommended Operating Conditions (GP1FA501RZ) $(T_a=25°C)$

Parameter	Symbol	MIN.	TYP.	MAX.	Unit
Operating supply voltage	V_{CC}	4.75	5.0	5.25	V
[*3][*4] Operating transfer rate	T	0.1	–	8	Mb/s
[*5] Input optical power level	P_C	−24	–	−14.5	dBm

*3 The above operating transfer rate is the value when NRZ signal, "0101.." continuous signal of duty 50% is transmitted
*4 The output (H/L level) of **GP1FA501RZ** are not fixed constantly when it receivers the modulating light (including DC light, no input light) less than 0.1Mb/s
*5 Peak optical output

■ Electro-optical Characteristics (GP1FA501TZ) $(T_a=25°C, V_{CC}=5V)$

Parameter	Symbol	Conditions	MIN.	TYP.	MAX.	Unit
Peak emission wavelength	λ_p	–	630	660	690	nm
Optical power output coupling with fiber	P_C	Refer to Fig.1	−21	−17	−15	dBm
Dissipation current	I_{CC}	Refer to Fig.2	–	4	10	mA
High level input voltage	V_{IH}	Refer to Fig.2	2	–	–	V
Low level input voltage	V_{IL}	Refer to Fig.2	–	–	0.8	V
Low→High delay time	t_{pLH}	Refer to Fig.3	–	–	100	ns
High→Low delay time	t_{pHL}	Refer to Fig.3	–	–	100	ns
Pulse width distortion	Δt_w	Refer to Fig.3	−25	–	+25	ns
Jitter	Δt_j	Refer to Fig.3	–	1	25	ns

■ Electro-optical Characteristics (GP1FA501RZ) $(T_a=25°C, V_{CC}=5V)$

Parameter	Symbol	Conditions	MIN.	TYP.	MAX.	Unit
Peak sensitivity wavelength	λ_p	–	–	700	–	nm
Dissipation current	I_{CC}	Refer to Fig.4	–	15	40	mA
High level output voltage	V_{OH}	Refer to Fig.5	2.7	3.5	–	V
Low level output voltage	V_{OL}	Refer to Fig.5	–	0.2	0.4	V
Rise time	t_r	Refer to Fig.5	–	12	30	ns
Fall time	t_f	Refer to Fig.5	–	4	30	ns
Low→High delay time	t_{pLH}	Refer to Fig.5	–	–	100	ns
High→Low delay time	t_{pHL}	Refer to Fig.5	–	–	100	ns
Pulse width distortion	Δt_w	Refer to Fig.5	−30	–	+30	ns
Jitter	Δt_j	Refer to Fig.6, P_C=−14.5dBm	–	1	30	ns
		Refer to Fig.6, P_C=−24dBm	–	–	30	ns

■ Mechanical Characteristics

Parameter	Symbol	Conditions	MIN.	TYP.	MAX.	Unit
Insertion force, withdrawal force	–	Initial value when a **GP1C331** in used.	6	–	40	N

Fig.1 Measuring Method of Optical Output Coupling with Fiber

GP1FA501TZ Unit to be measured

V_{IN} V_{CC} GND

V_{CC}

Standard optical fiber cable

D

Optical power meter (Anritsu) **ML93B**

The optical power meter must be calibrated to have the wavelength sensitivity of 660nm (0dB=1mW)
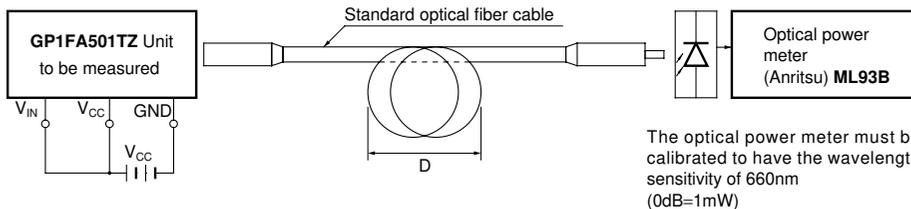
Note (1) V_{CC}; 5.0V (State of operating)
(2) To bundle up the standard fiber optic cable, make it into a loop with the diameter D=10cm or more
(The standard fiber optic cable will be specified elsewhere.)

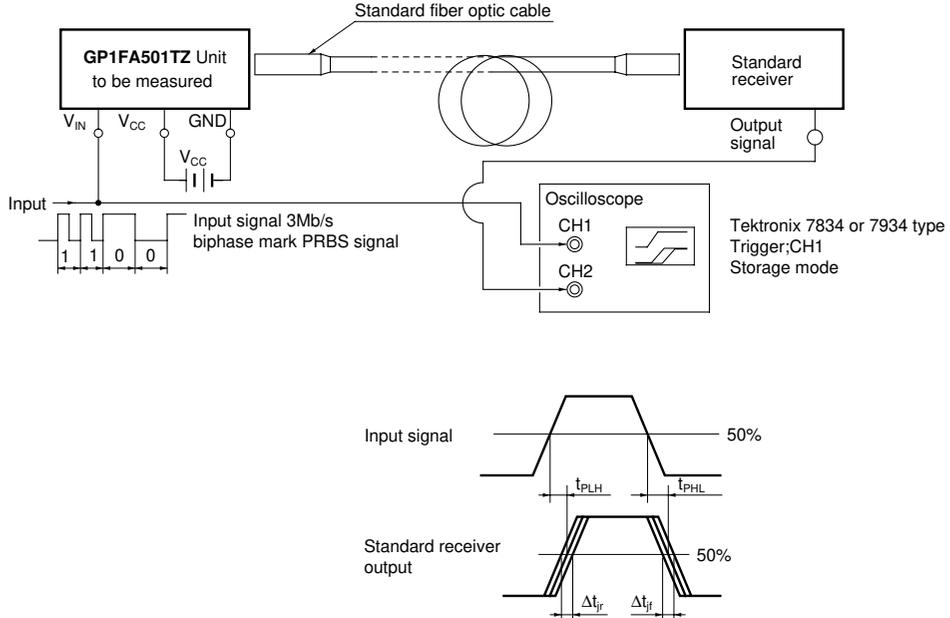## Fig.2 Measuring Method of Intput Voltage and Supply Current

GP1FA501TZ Unit to be measured

V_{IN} V_{CC} GND

I_{CC}

V_{IN} V_{CC}

Standard fiber optic cable

D

Optical power meter (Anritsu) **ML93B**

The optical power meter must be calibrated to have the wavelength sensitivity of 660nm (0dB=1mW)
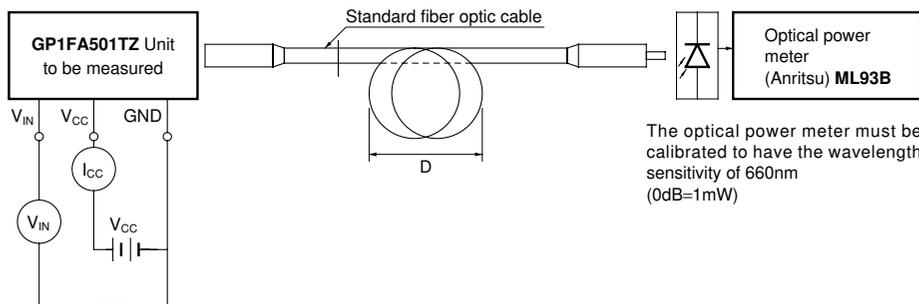
Input conditions and judgement method

Conditions	Judgement method
V_{IN}=2.0V or more	$-21 \leq P_C \leq -15$dBm, I_{CC}=10mA or less
V_{IN}=0.8V or less	$P_C \leq -36$dBm, I_{CC}=10mA or less

Note V_{CC}=5.0V (State of operating)

Fig.3 Measuring Method of Pulse Response and Jitter

Standard fiber optic cable

GP1FA501TZ Unit to be measured

V_{IN} V_{CC} GND

V_{CC}

Standard receiver

Output signal

Input

Input signal 3Mb/s biphase mark PRBS signal

1 1 0 0

Oscilloscope

CH1

CH2

Tektronix 7834 or 7934 type
Trigger;CH1
Storage mode

Input signal — 50%

t_{PLH} t_{PHL}

Standard receiver output — 50%

Δt_{jr} Δt_{jf}

Parameter	Symbol	Conditions
Low→High delay time	t_{pLH}	Refer to the above mentioned prescription
High→Low delay time	t_{pHL}	Refer to the above mentioned prescription
Pulse width distortion	Δt_w	$\Delta t_w = t_{pHL} - t_{pHL}$
Low→High jitter	Δt_{jr}	Set the trigger on the rise of input signal to measure the jitter of the rise of output
High→Low jitter	Δt_{jf}	Set the trigger on the fall of input signal to measure the jitter of the fall of output

Notes (1) The waveform write time shall be 4s. But do not allow the waveform to be distorted by increasing the brightness too much
    (2) V_{CC}=5.0V (State of operating)
    (3) The probe for the oscilloscope must be more than 1MΩ and less than 10pF

Fig.4 Supply Current

Input conditions		Measuring method
Supply voltage	V_{CC}=5.0V	Measured on an ammeter (DC average amperage)
Fiber coupling light output	P_C=−14.5dBm	
Standard transmitter input signal	6Mb/s NRZ, Duty 50% or 3Mb/s biphase mark PRBS signal	

Fiber optic cable

Standard transmitter

V_{IN} V_{CC} GND

5V

Input

GP1FA501RZ
Unit to be measured

V_{CC} GND V_{OUT}

Am meter V_{CC}
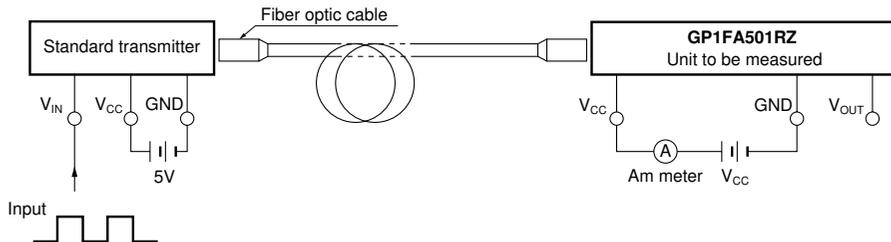
Fig.5 Measuring Method of Output Voltage and Pulse Response
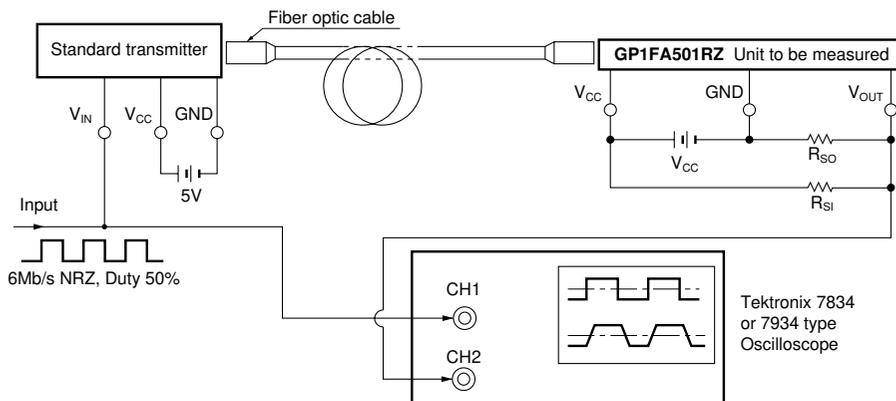
Test item

Test item	Symbol
Low → High pulse delay time	t_{pLH}
High → Low pulse delay time	t_{pHL}
Rise time	t_r
Fall time	t_f
Pulse width distortion $\Delta t_w = t_{pHL} - t_{pLH}$	Δt_w
High level output voltage	V_{OH}
Low level output voltage	V_{OL}

Notes (1) V_{CC}=5.0V (State of operating)
(2) The fiber coupling light output set at −14.5dBm/−24dBm
(3) The probe for the oscilloscope must be more than 1MΩ and less than 10pF
(4) R_{SI}, R_{SO}:Standard load resistance (R_{SI}:3.3kΩ, R_{SO}:2.2kΩ)
(5) The output (H/L level) of **GP1FA501RZ** are not fixed constantly when it receives the modulating light (including DC light, no input light) less than 0.1Mb/s
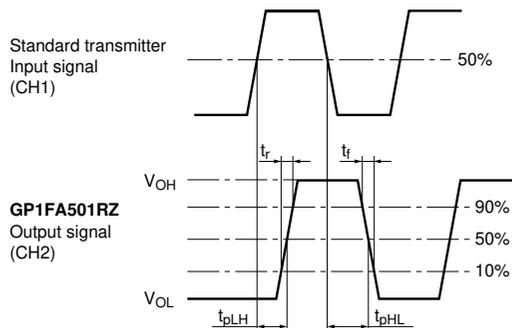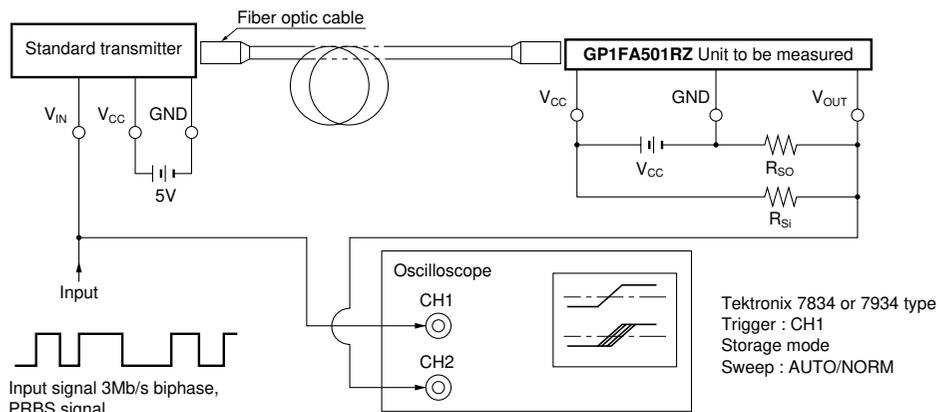
Fig.6 Measuring Method of Jitter

Test item

Test item	Symbol	Test condition
Jitter	Δt_j	Set the trigger on the rise of input signal to measure the jitter of the rise of output
Jitter	Δt_j	Set the trigger on the fall of input signal to measure the jitter of the fall of output

Notes (1) The fiber coupling light output set at −14.5dBm/−24dBm
(2) R_{SI}, R_{SO}:Standard load resistance (R_{SI}:3.3kΩ, R_{SO}:2.2kΩ)
(3) The waveform write time shall be 3s. But do not allow the waveform to be distorted by increasing the brightness too much
(4) V_{CC}=5.0V (State of operating)
(5) The probe for the oscilloscope must be more than 1MΩ and less than 10pF
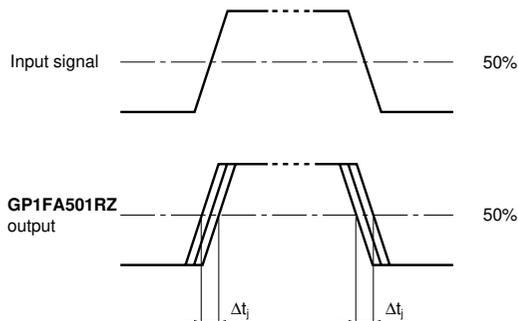
NOTICE

- The circuit application examples in this publication are provided to explain representative applications of SHARP devices and are not intended to guarantee any circuit design or license any intellectual property rights. SHARP takes no responsibility for any problems related to any intellectual property right of a third party resulting from the use of SHARP's devices.

- Contact SHARP in order to obtain the latest device specification sheets before using any SHARP device. SHARP reserves the right to make changes in the specifications, characteristics, data, materials, structure, and other contents described herein at any time without notice in order to improve design or reliability. Manufacturing locations are also subject to change without notice.

- Observe the following points when using any devices in this publication. SHARP takes no responsibility for damage caused by improper use of the devices which does not meet the conditions and absolute maximum ratings to be used specified in the relevant specification sheet nor meet the following conditions:

  (i) The devices in this publication are designed for use in general electronic equipment designs such as:
  --- Personal computers
  --- Office automation equipment
  --- Telecommunication equipment [terminal]
  --- Test and measurement equipment
  --- Industrial control
  --- Audio visual equipment
  --- Consumer electronics

  (ii) Measures such as fail-safe function and redundant design should be taken to ensure reliability and safety when SHARP devices are used for or in connection with equipment that requires higher reliability such as:
  --- Transportation control and safety equipment (i.e., aircraft, trains, automobiles, etc.)
  --- Traffic signals
  --- Gas leakage sensor breakers
  --- Alarm equipment
  --- Various safety devices, etc.

  (iii) SHARP devices shall not be used for or in connection with equipment that requires an extremely high level of reliability and safety such as:
  --- Space applications
  --- Telecommunication equipment [trunk lines]
  --- Nuclear power control equipment
  --- Medical and other life support equipment (e.g., scuba).

- If the SHARP devices listed in this publication fall within the scope of strategic products described in the Foreign Exchange and Foreign Trade Law of Japan, it is necessary to obtain approval to export such SHARP devices.

- This publication is the proprietary product of SHARP and is copyrighted, with all rights reserved. Under the copyright laws, no part of this publication may be reproduced or transmitted in any form or by any means, electronic or mechanical, for any purpose, in whole or in part, without the express written permission of SHARP. Express written permission is also required before any use of this publication may be made by a third party.

- Contact and consult with a SHARP representative if there are any questions about the contents of this publication.